


SLO – krmiljenje frekvenčnega pretvornika z zunanjim potenciometrom in stikalom: SEW Movitrac 07

Osnovna vezalna shema in pogoji delovanja

Nastavitve parametrov

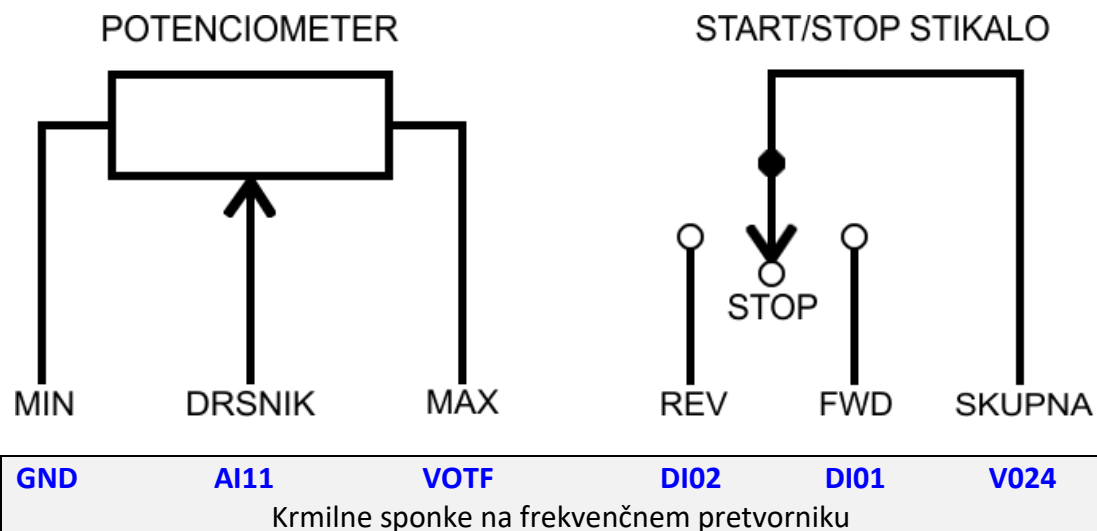

- vrednost potenciometra (linearna karakteristika, najmanj 0.5 W): 10 kΩ
- med sponki V024 in DI03 je potrebno vstaviti prevezavo
- med sponki GND in AI12 je potrebno vstaviti prevezavo
- stikalo S11 mora biti v položaju V (gor)

Po ponastavitvi parametrov na tovarniške vrednosti (P802 -> Yes) je potrebno spremeniti naslednje parametre:

- P803 -> off
- definicija reference: P100 -> 1
- definicija START/STOP: P101 -> 0
- MIN izhodna frekvenca: P301
- MAX izhodna frekvenca: P302
- čas pospeševanja: P130
- čas pojemanja: P131
- če na zaslonu utripa prikaz STOP: s tipkama gor/dol izberi simbol potenciometra in 1x pritisni tipko RUN (prikaz na zaslonu mora prenehati utripati)



SIGI elektronika, Žiga Divjak s.p.
Cesta 7/5
1310 Ribnica


www.sigi-elect.si
sigi@sigi-elect.si
sigi.elect@gmail.com

051 344 018 (Matija)
070 638 328 (Žiga)

ENG – variable frequency drive control with external potentiometer and switch (2-wire control): **SEW Movitrac 07**

Basic wiring diagram and operating conditions

Parameter settings

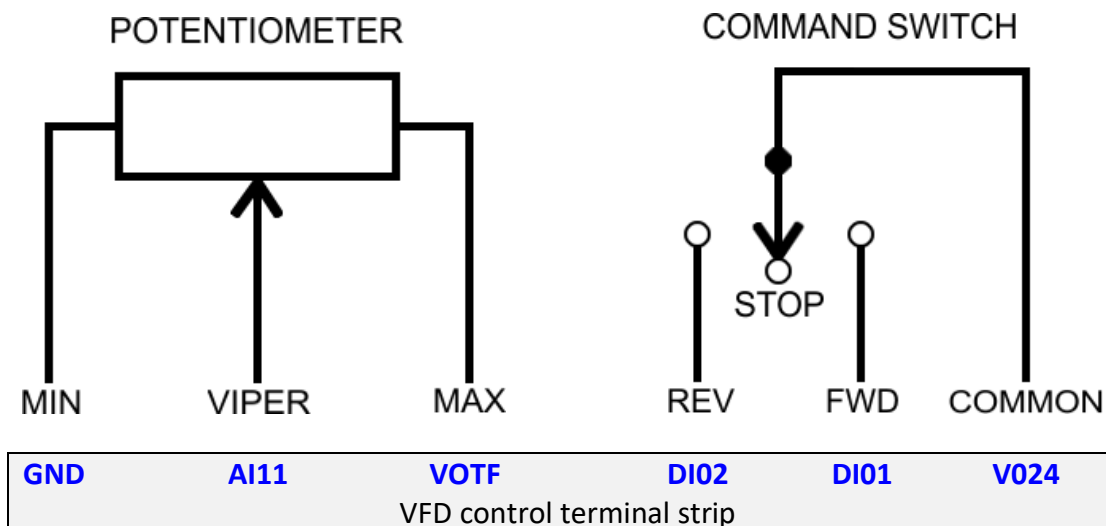

- potentiometer value (linear, at least 0.5 W): 10 k Ω
- control terminals V024 and DI03 must be bridged
- control terminals GND and AI12 must be bridged
- switch S11 must be in the V position (up)

If all VFD parameters are initialized to factory default values (P802 -> Yes), you only need to adjust the following parameters:

- P803 -> off
- frequency reference: P100 -> 1
- START/STOP command: P101 -> 0
- MIN out frequency: P301
- MAX out frequency: P302
- acceleration time: P130
- deceleration time: P131
- if STOP is flashing on the display: use up/down keys to select potentiometer symbol and 1x press the RUN key (display should stop flashing)



SIGI elektronika, Žiga Divjak s.p.
Cesta 7/5
1310 Ribnica
Slovenia

www.sigi-elect.si
sigi@sigi-elect.si
sigi.elect@gmail.com

00386 51 344 018 (Matija)
00386 70 638 328 (Žiga)